1.RN [T

TACAMPA 2294819-506,508/_ DMG ND. SHUTTLE CCTV 2307088-503 CRITICAL ITEMS LIST OF ERITCEALITY __2/2 FAILURE EFFECT FAILURE HODE AND RATIONALE FOR ACCEPTANCE ON END ITEM CAUSE Inability to control DESIGN FEATURES loss of Iris function focus, zoom, or iris. imechanical). The IVC/Lens Assembly is comprised of 16 electrical subassemblies; 13 subassemblies Loss of Zoom Function are RCA Astro designed and fabricated using standard printed-circuit board type of Horst Case: (mechanical). construction. The remaining three assemblies, high voltage power supply, oscillator, Loss of mission critical Loss of Facus Function and stepper motors, are vendor supplied components which have been specified and videa. purchased according to RCA Specification Control Drawings (SCDs) prepared by engi-(mechanical). neering and reliability assurance. Specifications per the SCD are prepared to establish the design, performance, test, qualification, and acceptance requirements WLA -Hotor failure for a procured piece of equipment. -Gear Irain failure -Lens failure Parts, materials, processes, and design guidelines for the Shuttle CCTV program are specified in accordance with RCA 2295503. This document defines the program requirements for selection and control of EEE parts. To the maximum extent, and consistent with availability, all parts have been selected from military specifications at the JAN level, as a minimum. In addition to the overall selection criteria, a subset of general purpose preferred parts has been defined by this document and the RCA Government Systems Division Standard Parts List. In the case of the CMDS and TTL family of microcircuits, devices are screened and tested to the MIL-SID-883C equivalent and procured under the designations of HI-REL/3MQ and SNC 54LS from RCA-SSD and Texas Instruments Corp, respectively. Parts not included in the above documents have been used in the design only after a nonstandard item approval form (MSIAF) has been prepared, submitted to Reliability Assurance Engineering (RAE) and approved for use in the specific application(s) defined in the MSIAF by MASA-JSC. Norst-Case Circuit Analyses have been performed and documented for all circuit designs to demonstrate that sufficient operating margins exist for all operating conditions. The analysis was worst case-in that the value for each of the variable parameters was set to limits that will drive the autput to a maximum (or minimum). A component application review and analysis was conducted to verify that the applied stress on each piece part by the temperature extremes identified with environmental qualification testing does not exceed the stress detailing values identified in RCA 2295503. In addition, an objective examination of the design was performed through a PDR and COR to verify that the TVC/Leas assembly met specification and contractual requirements.

FMEA NO. <u>5.3.8.2</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRITICAL JTEHS LIST	UNIT TYC/HLA OHG NO. 2294819-506,508/ 2307068-503 SHEET 2 OF 9
FAILURE HODE AND	FAILURE EFFECT	battonal f. too atro	
	Inability to control focus, good, or iris. Worst Case: Loss of mission critical video.	DESIGN FEATURES The general arrangement of the lens assembly is to motor, and circuit board package which can account lenses. Emphasis is placed on accessibility of the limit steps. Components within the lens assembly the MtA. CLA. and MtA assemblies. The lens housing structure is a one-piece casting provide a rugged dimensionally stable mounting fears in the form of a right angle. The vertical mention of the camera and the horizontal member supports with the lens function circuit boards in a cavity lens function. Orion the lens function circuit boards in a cavity lens function. Or the lens function of the iris train to provide the bility necessary for the ALC eperation. The table (on next page) shows the drive train may for the three lens functions. The motor/gear heads are mounted on the lens hous the desired lens interchangeability for the Shutt actual lenses. Various types of motors were considered for this weight, cantrol-circuit complexity, command capable three lens stepper motor types fit the package heing preferred hecause of its simplicity, reliab The selected stepper motor to size-0. Alnico-9 pois mated with a sport train gearhead. Both units A 48-diametral-pitch (48-0P) spur gear on the geamith the gears which are a park of the zoom, foculens gear.	or provide as integrated housing, codate various commercially available the lens, its drive components, and have been modularized, serving both designed to minimize machining and or the optical components. The bousing mber interfaces with the front surface the drive motors on the upper surface on the underside. The drive motors on the upper surface on the underside. The lens of the provided the lens of the le
	J ·		

FMEA NO5.3.6,2 CRITICALITY2/2			ĆRI	SHUTTLE CC	TV \$ L[S]				/NLA 2294819-1 2307088-1 OF	506,500/ 503 9
CAUSE Loss of Iris Function (mechanical). Loss of Zoom Function (mechanical). Loss of Focus Function (mechanical). WLA -Motor failure -Gear Irain failure -lens Failure	FAILURE EFFECT ON END ITEM Inability to centrol focus, zoom, or iris.	PESIGN FEATURES LENS DRIVE TRAIN PARAMETERS								
	Morst Case: Loss of mission critical videa.	Drive	Component.	Travel (degrees)	Time End- to-End (seconds)	Input Torque (az-in)	Ratio No. or Teeth	Efficiency (%)	loss Torque (oz-in)	Net Torque (ez-in)
		Žopn	H ator Gearhead Gearhead Output Gear	150	5.6	- 0.27 18.4	- 78:1 50	- 80 96	3.7	0.27 18.4 52.0
			Leas Gear		ļ	<u> </u>	156		10.0 Torque 5.2	Margin ;);
		focus	Noter Gearhead Gearhead	202	7.5	0.27	- 48:1	B 0	2.6	10.3
		Le Mu Iris Ge Ou	Output Gear Lens Gear			10.3	50 156	96	1.3 In.0 Terque	30.0 Hargin
			Motor Gearhead	105	2.8	- 0.21	48:1	- 640	2.6	0.27 10.3
			Gearhead Output Gear Lans Gear			10.3	50 156	96		30.0 Nargin

FHEA NO		SHUFFLE CCTV CRITICAL ITEMS LIST	UNIT TVC/VLA DUG NO. 2294819-506.508/_ 2307088-503 SHEET 4 OF 9
FAELURE MODE AND CAUSE Loss of Iris function (mechanical). Loss of Zoom Function (mechanical). (mechanical). HLA -Motor (ai)ure -Gear Train failure -lens failure	FAILURE EFFECT ON EAD LIEN Inability to control focus, zoom, or iris. Horst Case: toss of mission critical video.	RATIONALE FOR ACCEPTION And Angle Lens Assembly The Angenium lens used in the MIA was designed spawide angle arom lens 8 mm to 24 mm focal range havended range of 1-720 and a fully closed position is engineered into a rugged lens assembly utilizing anom and focus controls are cam-driven linear motic contacts. Hetion to the came is provided by ball interface with the lens function drive motor in the IRIS mechanism is a variable mechanical apertudensity wedge. The aperture plate and wedge are exhich again interfaces with the function drive mot care was exercised in the design to assure the optistrain-free, environmentally secure mountings. The lens assembly was qualification tested at the followed by qualification testing on the MIA systemen used on repetitive STS missions. QUALIFICATION TEST	ecifically for SIS CCTV use. It is aving a 3.9 minimum f-stop to an n. The high quality optical system g space-approved materials. The ons with dry-lubricated sliding bearing-supported gear rings which e MLA assembly. re with a superimposed neutral dge-driven by a spur gear ring or in the MLA housing. Ital elements are secured in vendor's facility; this was a at RCA. The assembly has
		for Qualification Test flow, see Table 2 located a	t the front of this book.

FMEA NO		SHUTTLE CCTV ONG NO. 2294819-506,508/				
		CRITICAL TIEMS LIST 2397008-503 SHEET 5 OF 9				
FATLURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	RATIGNALE FOR ACCEPTANCE				
		ACCEPTANCE TEST The CCTV systems' MLA is subjected directly, without vibration isolators which might be used in their normal installation, to the following testing: • Vibration: 20-80Hz: 3 88/0gt-rise from 0.01 6 ² /Hz 80-350 Hz: 0.04 6 ² /Hz 350-750 Hz: -3 dB/10 Dct-slope Test Duration: 1 Minute per Axis Test Level: 6.1 Grms • Thermal Vacuum: In a pressure of tK10-5 form, the temperature shall be as follows: 125° f: Time to stablize equipment plus 1 hour 25° f: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour 125° F: Time to stablize equipment plus 1 hour				
		In order to verify that CCTV components are operational, a test must verify the health of all the command related components from the PMS (A7A1) panel switch, through the RCD, through the sync lines to the Camera/PTU, to the Camera/PTU command decoder. The test must also verify the camera's ability to produce video, the Y5H's ability to route video, and the momitor's ability to display video. A similar test would be performed to verify the HDM command path.				
	1	Pre-Launch on Orbiter Test/In-Flight Tust				
		 Power CCTV System. Via the PHS panel, select a monitor as destination and the camera under test as source. Send "Camera Power On" command from PHS panel. Select "External Sync" on monitor. Observe video displayed on monitor. Note that if video on monitor is synchronized (i.e., stable raster) then this indicates that the camera is receiving composite sync from the RCU and that the camera is producing synchronized video. Send Pan, Tilt, focus, Zoom, DLR, AND Ganna commands and visually (either via the monitor or direct observation) verify operation. Select downlink as destination and camera under test as source. Observe video routed to downlink. Send "Camera Power Off" command via PHS panel. 				
7.46D	5-	10. Repeat Staps 3 through 9 except issue commands via the NOH command path. 208 This proves that the CCIV _quipment is operational.				

FHEA NO. <u>5.3.6.2</u>	SHUTTLE CCTV	UNIT <u>IVC/HLA</u> DMG NO. <u>2294819-506.508/</u>
CRITICALITY 2/2	CRIFICAL ITEMS LIST	2307088=503 SHEET <u>6</u> OF <u>9</u>
FATILIZE MODE AND		

FAILURE MODE AND
CAUSE
Less of Iris function
(mechanical).
Loss of Zoom Function
(mechanical).
Loss of Focus Function
(mechanical).
MLS

ML) -Motor failure -Gear Train failure -Lens failure Inability to control focus, zoom, or Irls.

Worst Case: Loss of mission critical video.

OA/INSPECTION

<u>Procurement Control</u> - The TVC/NLA EEE Parts and hardware items are procured from approved vendors and suppliers, which meet the requirements set forth in the CCTV contract and Quality Plan Work Statement (VS-2593176). Resident OCAS personnel review all procurement documents to establish the need for GSI on selected parts (PAI 517).

RAJIONALE FOR ACCEPTANCE

Incoming Inspection and Storage - Jacobing Quality inspections are made on all received materials and parts. Results are recorded by lot and retained in file by drawing and control numbers for future reference and traceability. All EEE parts are subjected to incoming acceptance tests as called for in PAI 315 - Incoming Inspection last Instructions. Incoming flight parts are further processed in accordance with RCA 1846684 - Preconditioning and Acceptance Requirements for Electronic Parts, with the exception that OPA and PINO testing is not performed. Mechanical items are inspected per PAI 316 - Incoming Inspection Instructions for mechanical items, PAI 365 - Incoming Quality Control Inspection Instruction, and PAI 612 - Procedure for Processing Incoming or Purchased Parts Designated for Flight Use. Accepted items are delivered to Naterial Controlled Stores and retained under specified conditions until fabrication is required. Non-conforming materials are held for Haterial Review Board (MRB) disposition. (PAI 307, PAI 100 531).

<u>Board Assembly & Test</u> - Prior to the start of WtA board assembly, all items are verified to be correct by stock room personnel, as the items are accumulated to form a kit. The items are verified again by the operator who assembles the kit by checking against the as-built-parts-list (ABPL). DCAS Mandatory Inspection Points are designated for all printed circuit, wire wrap and welded wire boards, plus barness connectors for soldering wiring, crimping, solder splices and quality workmanship prior to coating of the component side of boards and sleeving of harnesses. Specific instructions are given in assembly drawing notes and applicable documents called out in the fabrication procedure record (FPR-2307068) and Parts List PL 2307088. These include wire connection list 2303349. Notes - wide angle zoon lens assy 2303191, Process Standard - bonding staking, patting, encapsulating 2280878, Specification - Urethane protective coating 2280877 and Horkmanship Spec 8030035.

<u>TYC Assembly and Jest</u> - An open box test is performed per TP-II-2294819, and an Acceptance lest per TP-AI-2294819, including vibration and thermal vacuum. Torques are specified and witnessed, traceability numbers are recorded and calibrated tools are checked prior to use. RCA Quality and DCAS inspections are performed at the completion of specified FPR operations in accordance with PAI 204, PAI 205, PAI 206 and PAI 217. DCAS personnel witness IVC button-up and critical torquing.

FMEA NO. <u>5.3.8.2</u>		SHUTTLE CCTV	UNIT TYC/HLA DHG NO. 2294019-506.508/
CASTICALITY 2/2		CRITICAL ITEMS LIST	SHEET 7. OF 9
	FAILURE EFFECT ON END TIEN Inability to control focus, zoom, or iris. Morst Case: toss of mission critical video.	RATIONALE FOR ACCEPTA QA/INSPECTION (Continued) WLA Assembly and Test — An open box test is perform Test per IP—AI—2307080. Torques are specified and views are performed at the completion of specified in PAI 204, PAI 205, PAI 217 and PAI 402. DCAS persons critical torquing. IVC/VIA Assembly and Test — After a IVC and a MIA his they are mated and a final acceptance test is perfor vibration and thermal vacuum environments. RCA and tests and review the acceptance test data/results. after all repair, rework and retest. Preparation for Shipment — The IVC and MIA are separfabrication and tasking is complete. Each is packaged and 2288746, Process standard for Packaging and Hand documentation including assembly drawings, Parts Ligathered and held in a documentation folder assigned this folder is retained for reference. An EIOP is accordance with the requirements of MS—2593176. RCC crating, packaging, packing and marking, and review accuracy.	ed per IP-IT-2307088, Acceptance vitnessed, traceability numbers are use. RCA Quality and DCAS inspected witness WLA button-up and witness WLA button-up and live been tested individually, med per IP-AT-2294819, including DCAS personnel monitor those These personnel also inspect rated prior to shipment after ged according to CCTV Letter 8011 dling guidelines. All related st. ABPL, Iest Data, etc., is d specifically to each assembly. prepared for each assy in a OC and OCAS personnel witness

REVISED 11-3-66

FHEA NO. 5.3.6.2 ENITICALITY 2/2 FAILURE HODE AND (AUSC Loss of Iris function (mechanical). Loss of Zoon function (mechanical). WLA Hotor failure Gear Train failure -tens failure	FAILURE EFFECT ON END STEM Inability to central facus, zoom, or iris. Harst Case: Loss of mission critical video.	SHUTTLE CCTV CRITICAL TIEMS LIST RATIONALE FOR ACCEPTANCE FAILURE HISTORY TOR W-6848, Leg #0923, WLA 005-561 TDR A-2549, Leg #0906, MLA 005-561 Description: Flight Failure. Spacecraft Level. Loose element observed in lens. Cause: Retaining ring holding lens in place was loose. This retaining ring is hald in place by using a staking material, which was missing. Corrective Action: All of the evidence indicates this failure to be an isolated instance of an omitted manufacturing step. Since this failure, vendor has prepared a detailed manufacturing procedure with proper QC inspection checks to insure proper production.				

FHEA NO. <u>5.3.6.2</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRITICAL LIENS LIST	UNIT <u>TVC/WLA</u> DWG NO. 2294819-506.508/ 2307088-503 SMEET <u>9</u> OF <u>9</u>			
FAILURE HODE AND CAUSE Loss of 1ris function (machanical). Loss of Zoom Function (mechanical). Loss of Focus Function (mechanical).	FAILURE EFFECT ON END ITEM Inability to control focus, zeom, or iris. Worst Case: Loss of mission critical video.	OPERATIONAL EffECTS Loss of video. Possible loss of major mission objectives due to loss of RMS cameras or other regulated cameras. CREM ACTIONS				
MLS -Hotor failure -Gear Train failure -Lens failure		If possible, continue RMS operations using alternative visual coas. CREM_TRAINING Crew should be trained to use possible alternatives to CCTV. MISSION COMSTRAINI Where possible, procedures should be designed so they can be accomplished without CCTV.				
•						